



# NREL Small Wind Turbine Test Project: Mariah Power's Windspire Wind Turbine Test Chronology


A. Huskey and T. Forsyth

*Technical Report*  
NREL/TP-500-45552  
June 2009



NREL is operated for DOE by the Alliance for Sustainable Energy, LLC

Contract No. DE-AC36-08-GO28308

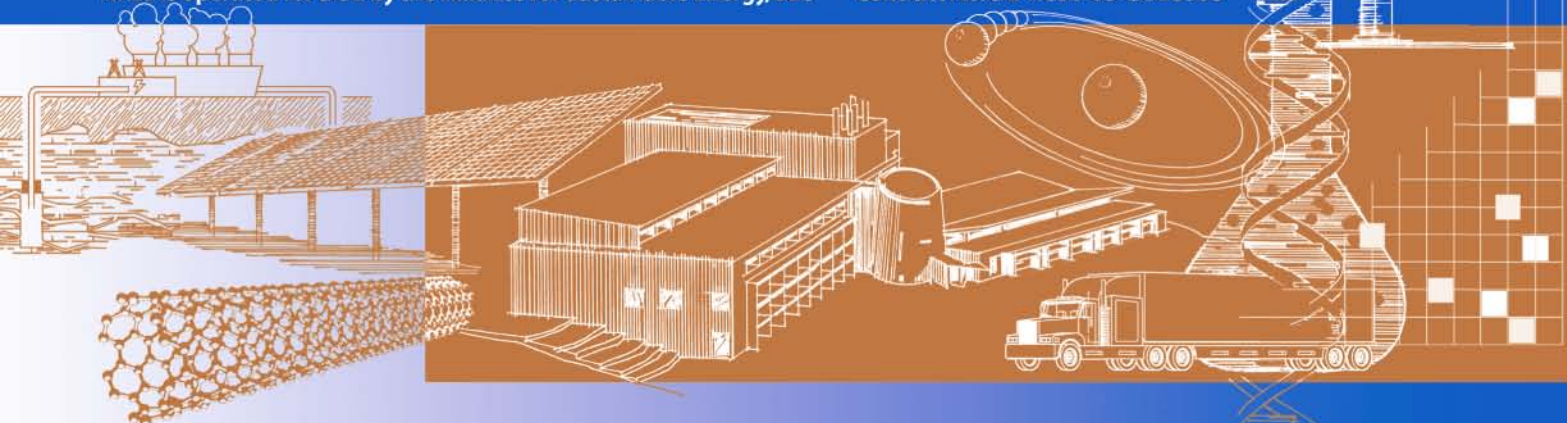


# NREL Small Wind Turbine Test Project: Mariah Power's Windspire Wind Turbine Test Chronology

*Technical Report*  
NREL/TP-500-45552  
June 2009

A. Huskey and T. Forsyth

Prepared under Task No. WER9.4501

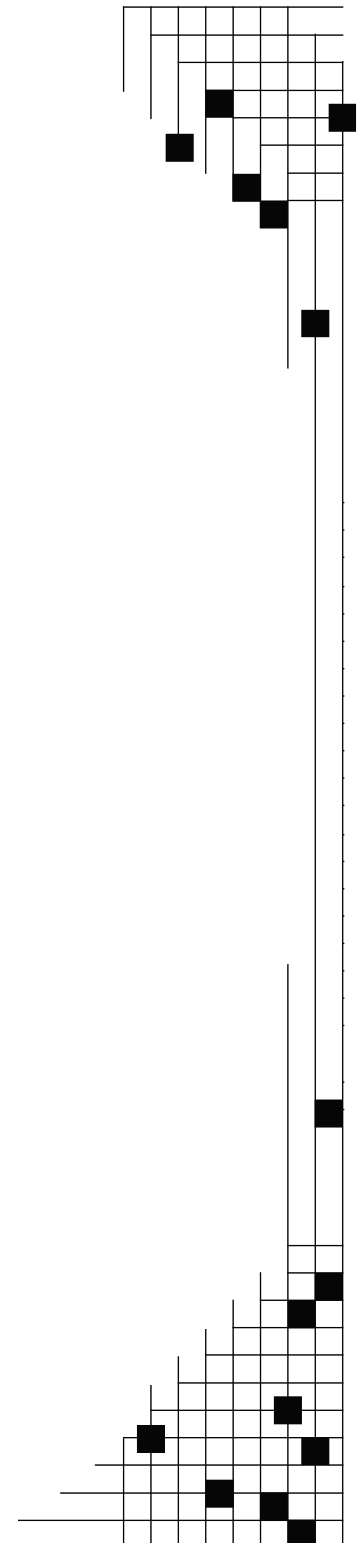

**National Renewable Energy Laboratory**  
1617 Cole Boulevard, Golden, Colorado 80401-3393  
303-275-3000 • [www.nrel.gov](http://www.nrel.gov)

NREL is a national laboratory of the U.S. Department of Energy  
Office of Energy Efficiency and Renewable Energy  
Operated by the Alliance for Sustainable Energy, LLC

Contract No. DE-AC36-08-GO28308

## NOTICE

This report was prepared as an account of work sponsored by an agency of the United States government. Neither the United States government nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States government or any agency thereof.

Available electronically at <http://www.osti.gov/bridge>

Available for a processing fee to U.S. Department of Energy and its contractors, in paper, from:

U.S. Department of Energy  
Office of Scientific and Technical Information  
P.O. Box 62  
Oak Ridge, TN 37831-0062  
phone: 865.576.8401  
fax: 865.576.5728  
email: <mailto:reports@adonis.osti.gov>

Available for sale to the public, in paper, from:

U.S. Department of Commerce  
National Technical Information Service  
5285 Port Royal Road  
Springfield, VA 22161  
phone: 800.553.6847  
fax: 703.605.6900  
email: [orders@ntis.fedworld.gov](mailto:orders@ntis.fedworld.gov)  
online ordering: <http://www.ntis.gov/ordering.htm>



## Introduction

To help industry offer consumers more small wind turbine systems that are certified for safety and performance, the National Renewable Energy Laboratory (NREL) and the U.S. Department of Energy (DOE) launched a Small Wind Independent Testing project in 2007. The small wind turbines will be tested to standards adopted by the International Electrotechnical Commission (IEC) and in compliance with the draft American Wind Energy Association (AWEA) standards for small wind turbine systems.

The resultant test data may be used by the Small Wind Certification Council (SWCC), a nonprofit organization formed with support from the DOE, AWEA, state energy offices, and turbine manufacturers to certify small wind turbine systems. SWCC certification is expected to commence in 2009. Test data could also be submitted to international certification agents as partial input for international certification.

Small wind turbines that are tested and certified will give consumers greater confidence that the systems they install will perform within specified wind regimes as advertised by the manufacturer.

Through a competitive solicitation, NREL selected four commercially available small wind turbine systems to test in 2008/2009 at its National Wind Technology Center near Boulder, Colorado. One of the small wind turbines selected for testing was Mariah Power's Windspire Giromill. The Windspire is a 1.2-kW vertical-axis wind turbine. The turbine tower is 9.1 meters tall, and its rotor area is 1.2 x 6.1 meters. The turbine has a permanent-magnet generator with a single-phase output at 120 volts AC.




**Mariah Power's 1.2-kW vertical-axis Windspire Giromill wind turbine installed for testing at the NWTC.**

This report presents a chronology of the tests conducted and a letter from Mariah Power to NREL after the tests were terminated on January 14, 2009.

### Mariah Windspire Project Summary

Activity	Status
<b>Award of Subcontract</b>	February 5, 2008
<b>Preparation for Installation</b>	Foundation poured: February 21, 2008 Components received: March 7, 2008 Inverter received: May 2, 2008 Documentation received: May 8, 2008
<b>Turbine Installation</b>	Turbine Installed: March 17, 2008 Inverter Installed: May 5, 2008
<b>Turbine Commissioning</b>	May 15, 2008
<b>Turbine O&amp;M and Testing</b>	
Safety and Function	Testing terminated 1/14/09
Power Performance	Testing terminated 1/14/09
Hrs of valid data (60 required)	299
Bins completed (3-14 m/s required)	0.5 - 13.5
Acoustic Noise	Testing terminated 1/14/09
Power Quality	N/A
Duration Test	Testing terminated 10/27/08
Months of operation (6 required)	4.8
Hours of power production (2,500 required)	831.3
Hours of power production in winds above 7.2 m/s (250 required)	132.9
Hours of power production in winds above 10.8 m/s (25 required)	12.5
KWH of production, cumulative	108
<b>Post-test Inspection</b>	Not started
<b>Final Documentation</b>	Not started
<b>Project Review Meeting</b>	Not started

## Windspire Cumulative Power Production from May through November 2008

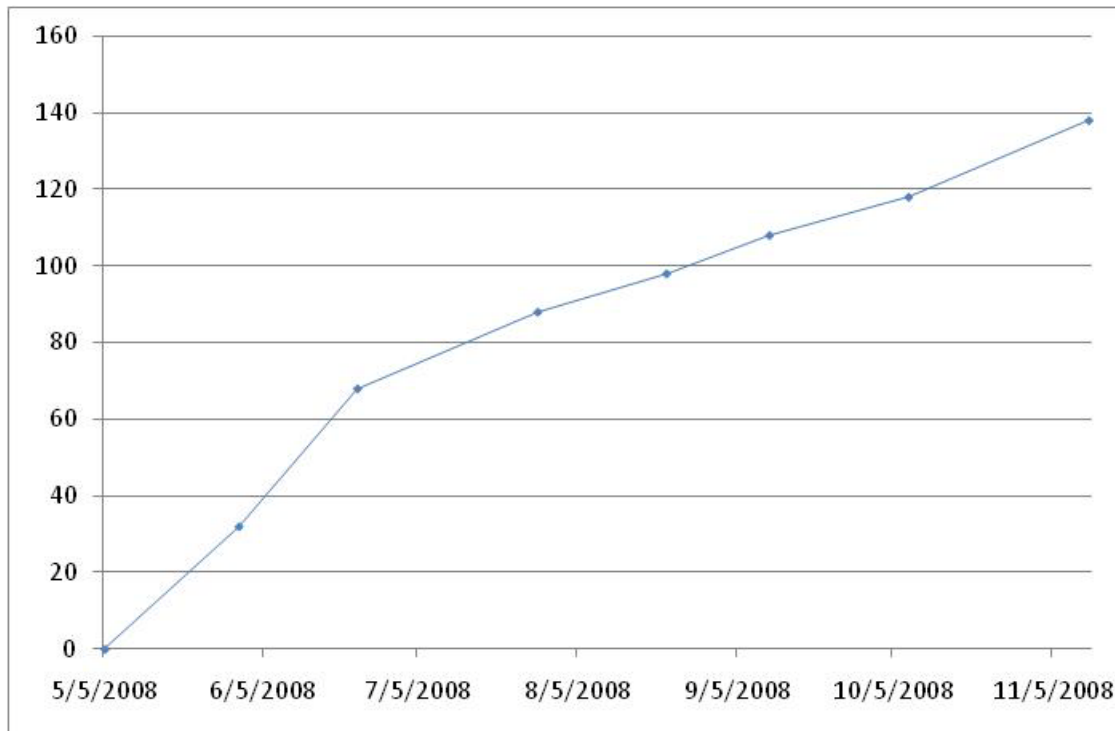

## Mariah Power's Windspire Wind Turbine Test Chronology

### Notable events:

- 5/5/08 The turbine was fully installed and operational. The turbine was installed without the inverter on March 17, 2008. The inverter was not installed until May 5, 2008.
- 5/9/08 Two screws were found missing at the top of the turbine where the ring attaches to the airfoil. The tower base bolts/nuts were retightened/loosened and marked to show alignment.
- 6/12/08 The inverter parameters were changed to increase output at rated levels from 1,000 watts to 1,100 watts.
- 6/23/08 The testing team found two loose bolts at the tower base. The nuts were retightened and remarked, and a small adjustment was made to vertical.
- 7/21/08 Routine inspection found a noise emanating from the turbine, a broken washer, loose nuts, and movement in the base tower plate.

7/30/08



While the leading edge tape was being replaced (due to detachment), a broken weld was found at the top of the turbine and another crack was observed on a different weld. Initially, the welding was done in two spots per airfoil side. The airfoils also slid out of the struts that are supposed to clamp them. This may have caused the broken weld. The turbine was visibly wobbling and was tilted down.

8/7/08

The manufacturer was on-site to replace the airfoils and struts. This is a change that will be required for all production machines. The tower base bolts were replaced with bolts with set screws to keep bolts from loosening. The weld was improved to a continuous weld.

8/18/08

The magnetic bearing was replaced. The initial magnetic bearings did not have a dust cover and were susceptible to iron dust getting into the magnetic air gap, which can stop operation of the turbine.

9/13/08



The inverter failure occurred because the set points of the inverter were set to optimize power performance. The increased performance caused the temperature to rise, and over time, caused the inverter to fail. The inverter was replaced. The set points were set for normal production.

10/7/08

The power performance test was stopped because the inverter failed. The test was not completed because the wind speed range requirement was not fulfilled/met. A new power performance test was started after the inverter was replaced.

10/14/08

Mariah informed us that: “the welding of the top shaft has not been stress relieved properly and has a heat affected zone that has reduced strength and fatigue life below the design.” Based on the findings from an accelerated life test conducted at the Mariah facility, Mariah requested that the testing team stop and/or lower the turbine in winds above 40 mph until a fix could be implemented, The fix is not expected until January 2009.

The testing team complied with Mariah’s request. However, they decided to terminate duration testing because the turbine did not meet the operation requirements. The testing team decided to continue power performance and noise testing.

10/21/08

The testing team confirmed that the turbine does not shut down in high winds.

10/30/08

The testing team found three loose nuts at the base of the tower. The nuts were tightened per Mariah’s direction.




11/19/08



Two out of three airfoils slid down through the struts. In the picture, the black markings show where the airfoils used to be.

12/16/08

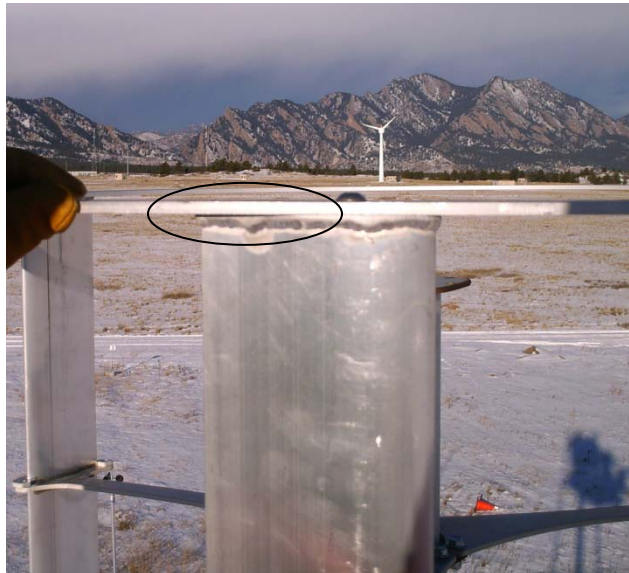

During the noise testing, a clanging sound emanated from the turbine. The testing team found two broken welds at the top of the turbine. The turbine was shut down until further notice. This photo shows one of the broken welds that caused the airfoil to separate from its end plate. However, the airfoil did not completely separate as it did in the previous occurrence.

1/14/09



The testing team checked the turbine after it observed possible higher rotational speeds while the turbine was shut off. Measurements that were taken to check for generator continuity were varied when they should have been less than 5 ohms. The team found that two of the three wires from the generator were missing insulation and bare wire was exposed. There was no noticeable difference in resistance when force was applied while the generator was connected or not.

The turbine was lowered.

Testing  
Update

Noise data was not collected.

Duration testing was terminated in October 2008.

The safety and function test was mostly completed and a report will be written with exceptions.

Power performance data collection for the two inverters were almost completed, the last required wind speed bin was not filled. A test report will be written with exceptions.

# Letter from Mariah Power

4/29/09



Mariah Power Response to NREL Small Wind Testing, Chronology of Events

Mariah Power thanks NREL and the staff at the Wind Technology Center for providing the opportunity to test the Windspire, and for sharing feedback in order to help us improve our product. That said, we were disappointed with the turbine component failures during the field testing at the National Renewable Energy Laboratory's Wind Technology Center (WTC) site, and the subsequent discontinuation of testing. The Windspire was a brand new product at the time testing began, and the unit provided for the test was one of our earliest production units.

In addition to testing at the WTC, Mariah Power deployed 100 units to the field as part of our 100 Unit Field Program and continued independent testing. By selecting these diverse sites, some in extreme conditions, we tried to simulate the variety of conditions in which the Windspire was designed to operate. As a result of the WTC and these other programs, we were able to identify and rectify several product design issues early in our production phase.

The problems identified at the WTC and in the field have been closely analyzed and put through a rigorous engineering change order process to remedy. Consequently, the following changes in our design and manufacturing processes have been instituted:

- New air foils replace welded end plates. These end plates are now secured with stainless steel M8 fasteners.
- The safety rings are now segmented and attached with mechanical fasteners. These replaced the butt welded rings.
- The airfoil clamping system was redesigned which provides for a more concentric gripping force. These new opposing clamps secure the airfoils from slippage.
- We have engineered stiffer and straighter shafts, and added ¼ inch thickness to the base plate. These help improve longevity and address early modal/resonance disturbances.
- The loose nuts encountered on this test unit were not encountered on any of the other field units. We believe this issue arose on the test unit due to undue stress from poor shaft straightness (see above).
- A new clamping method was developed to secure the top shaft and generator in order to eliminate fretting.

In addition, Mariah Power has introduced other product upgrades since the first units were shipped. The benefit of a complete field test program and other independent test sites is that we can identify and address potential issues quickly, and also make improvements to the existing technology.

We were disappointed that our inverter had so many issues on the electrical side. Several factors have been changed in our inverter since UL approval, to improve reliability, power output and safety. We are working closely with ETL to incorporate these changes in our UL certification:


- Revised boost transformer to lower the internal temperature of the transformer
- Added thermal sensing to maximize wattage output while maintaining electrical integrity by shutting down when thermal limits are reached.
- Improved firmware control to better manage the power output and system control in high wind.

Finally, Mariah Power has implemented more quality control measures for its current production units. We have partnered with a top US manufacturing company, MasTech Manufacturing based in Manistee, Michigan. MasTech has manufactured for many top US and foreign car companies and is well known for its expertise in meeting stringent quality controls. We have put in place critical components to our new manufacturing processes:

- Hired AWS certified welders.
- Hired an ASQ certified quality engineer to manage the quality process at Mastech Manufacturing.
- Combined wrought multi-piece components into steel and aluminum castings.
- Put holding fixtures for component fabrication in place to provide consistent machining of the parts.
- Use plug and ring gauges for functional inspection of critical dimensions to ensure consistency of systems.

We are continuing and expanding our own third party testing programs to ensure we integrate testing methodologies and results into our own programs. We look forward to the upcoming AWEA standards for small wind turbines and testing against these requirements once ratified.

Respectfully Yours,

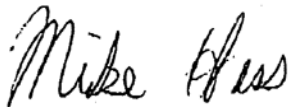A handwritten signature in black ink that reads "Mike Hess". The signature is written in a cursive, slightly slanted style.

Mike Hess, on behalf of the entire Mariah Power team  
(Signed for Mike Hess with his permission)

# REPORT DOCUMENTATION PAGE

*Form Approved*  
*OMB No. 0704-0188*

The public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing the burden, to Department of Defense, Executive Services and Communications Directorate (0704-0188). Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to any penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.

**PLEASE DO NOT RETURN YOUR FORM TO THE ABOVE ORGANIZATION.**

<b>1. REPORT DATE (DD-MM-YYYY)</b> June 2009			<b>2. REPORT TYPE</b> Technical Report		<b>3. DATES COVERED (From - To)</b>	
<b>4. TITLE AND SUBTITLE</b> NREL Small Wind Turbine Test Project: Mariah Power's Windspire Wind Turbine Test Chronology				<b>5a. CONTRACT NUMBER</b> DE-AC36-08-GO28308		
				<b>5b. GRANT NUMBER</b>		
				<b>5c. PROGRAM ELEMENT NUMBER</b>		
<b>6. AUTHOR(S)</b> A. Huskey and T. Forsyth				<b>5d. PROJECT NUMBER</b> NREL/TP-500-45552		
				<b>5e. TASK NUMBER</b> WER94501		
				<b>5f. WORK UNIT NUMBER</b>		
<b>7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)</b> National Renewable Energy Laboratory 1617 Cole Blvd. Golden, CO 80401-3393				<b>8. PERFORMING ORGANIZATION REPORT NUMBER</b> NREL/TP-500-45552		
<b>9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)</b>				<b>10. SPONSOR/MONITOR'S ACRONYM(S)</b> NREL		
				<b>11. SPONSORING/MONITORING AGENCY REPORT NUMBER</b>		
<b>12. DISTRIBUTION AVAILABILITY STATEMENT</b> National Technical Information Service U.S. Department of Commerce 5285 Port Royal Road Springfield, VA 22161						
<b>13. SUPPLEMENTARY NOTES</b>						
<b>14. ABSTRACT (Maximum 200 Words)</b> This report presents a chronology of tests conducted at NREL's National Wind Technology Center on Mariah Power's Windspire 1.2-kW wind turbine and a letter of response from Mariah Power.						
<b>15. SUBJECT TERMS</b> Small wind independent testing; Mariah Power; Windspire Giromill vertical-axis wind turbine; small wind						
<b>16. SECURITY CLASSIFICATION OF:</b>			<b>17. LIMITATION OF ABSTRACT</b>  UL	<b>18. NUMBER OF PAGES</b>	<b>19a. NAME OF RESPONSIBLE PERSON</b>	
<b>a. REPORT</b> Unclassified	<b>b. ABSTRACT</b> Unclassified	<b>c. THIS PAGE</b> Unclassified			<b>19b. TELEPHONE NUMBER (Include area code)</b>	

**Standard Form 298** (Rev. 8/98)  
Prescribed by ANSI Std. Z39.18